
8.38 ALARM 972 (NMI ALARM)

NMI has generated in a board other than the main CPU board.

Causes and Remedies

- 1) Any of option boards shown below may be faulty.
- · Option 1 board
- · Option 2 board
- · Option 3 board
- · Loader control board
- 2) The PMC control module may be faulty

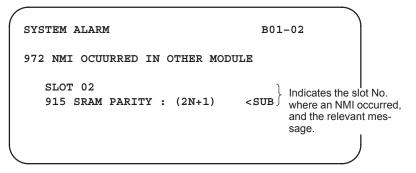

Replace the board in the indicated slot.

CAUTION

When you change option 2 board, you must input data (parameters, programs, etc.) on sub side. When you change loader control board, you must input data

(parameters, programs, etc.) on loader side.